



Technical release

Are you prepared to compromise on the integrity of your completion?

Mixing VAM copies with NEW VAM in one same string may lead to operational failures

Not convinced yet?

Please see hereafter physical test results


May you require any further information or assistance, please do not hesitate to come back to us
mr.help@vamservices.com

Mixing VAM copies with NEW VAM in one same string



Seal damage

Testing procedures show 1 end over 4 out of tolerance

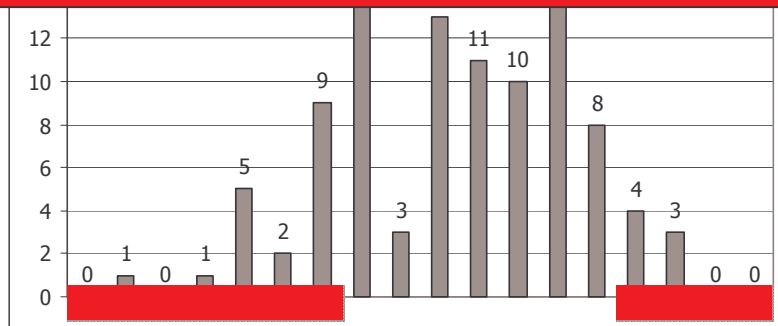

Physical tests results - Pin "VAM copy" / box NEW VAM			
	Make & Breaks	Internal pressure	Tension
7" 29 lb/ft VAM copy A	Seal damage	Leakage	Jump out
7" 26 lb/ft VAM copy B	OK	Leakage	OK

Physical tests results - Pin NEW VAM / box "VAM copy"			
	Make & Breaks	Internal pressure	Tension
7" 29 lb/ft VAM copy A	OK	Leakage	OK
7" 26 lb/ft VAM copy B	OK	Leakage	OK



Jump-out

May you require any further information or assistance, please do not hesitate to come back to us mr.help@vamservices.com